


Nn3 1920's PLYMOUTH MODEL HL TYPE 2 20 TON GASOLINE LOCOMOTIVE

GENERAL: CHASE ALL HOLES WITH APPROPRIATE SIZED DRILLS,
CAREFULLY TAP THREADED HOLES WITH 00-90 TAP WORKING
SLOWLY SO NOT TO CRACK RESIN PRINT.

PACK NOSE AND REAR OF CAB WITH TUNGSTEN PUTTY TO INCREASE WEIGHT.

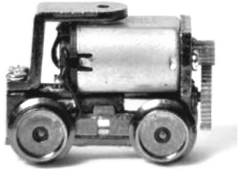

POWERMAX 6.5MM GAUGE
1MM WB POWER TRUCK
(REMOVE TOP PIVOT MOUNT)

GOLD MEDAL MODELS
HANDRAIL STANCHIONS

.012" BRASS WIRE

CLASS LIGHT - DRILL
W/ #80 DRILL

HEADLIGHT - MOUNT
ON FRONT GRILL

CUT FROM GOLD MEDAL
MODELS FIRE ESCAPE
ETCHING

COUPLER BOXES MAY
BE A TIGHT FIT DUE
TO HEAT ASSEMBLY OF
BOX - FILES SIDES IF
REQ'D.

00-90 SCREWS (NOT INCL.)

CUT AND BEND .012" BRASS WIRE TO FIT IN HOLES
IN END OF AIR TANKS; DO NOT GLUE IN SO CAN BE
REMOVED LATER IF REQ'D.

REMOVE PMAX
COVER PLATE -
RE-USE SCREWS

IF REQ'D., DEEPEN SLOT IN FOOTPLATE
FOR FRONT GRILL WITH RAZOR SAWL

